



LOM PRAHA

100 38 PRAHA 10 - MALEŠICE • ČERNOKOSTELECKÁ 270

CZECH REPUBLIC

SERVICE BULLETIN NO.:

M 332/78a	M 337/89a
M 332A/11a	M 337A/13a
M 332AK/10a	M 337AK/10a
M 132A/8a	M 337AK.1/9a
M 132AK/8a	M 337B/1a
M 137A/19a	M 332B/1a
M 137AZ/14a	

Concerns : Determination of the tightening moment for the fixing screws of the oil pumps S/N : Sh 0059, Sh 0060, Sh 0060AK, Sc 0060 and Sh 0060 A,B,C,D (M337B, M332B engines).

Cause : Elimination of the pump body deformation caused by the excessive tightening of the fixing screws.

Measures : In case of the oil pump mounting to the engine, tighten the screws Sc 6063 or Sh 6039 (M 337B and M332B engines) using the tightening moment 10 ± 1 Nm. Exceeding of the tightening moment is prohibited.

Costs : No costs

Bulletin validity : At the day of receipt

In Prague : 18.12.1998

Dipl. Eng. Josef Pietrik
DAR

Dipl. Eng. Vladimír Zasadil, CSc.
Producers representative